

Test Report No.: SDHL1703004942FT Date: Sep.26, 2017 Page 1 of 7

MERRYFAIR CHAIR SYSTEM SDN BHD NO. 2, JALAN KORPORAT 1/KU9, TAMAN PERINDUSTRIAN MERU, KAPAR, 42200 SELANGOR, MALAYSIA.

The following sample(s) was / were submitted and identified on behalf of the client as:

Sample Description : SPORTA PUBLIC SEATING

Buyer Item No. : 1085 FD A00 AJ Sample Receiving Date : Mar.24, 2017 Sample 1st Resubmission Date : May 15, 2017 Sample 2nd Resubmission Date : Sep.20, 2017

Test Performing Date : Mar.24, 2017 to Sep.26, 2017

Test Result Summary

Test(s) Requested	Result(s)
ANSI/BIFMA X5.4 - 2012	PASS
Summary	

Summary:

1. For further details, please refer to the following page(s).

Signed for and on behalf of Shunde Branch SGS-CSTC Co., Ltd.

Caming Fan Approved signatory





Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention:To check the authenticity of testing / inspection report & certificate, please contact us at telephone:(86-755) 8307 1443, or email: CN.Doccheck@sgs.com

1F;1⁴ Building,European Industrial Park,No.1 Shunthe South Road, Wisha Section, Dallarg Town, Shunde,Fostran, Guangdong, China 528333 t (86–757)22805888 f (86–757)22805858 www.sgs.group.com.cn



Test Report No.: SDHL1703004942FT Date: Sep.26, 2017 Page 2 of 7

TESTS AND RESULTS

Test Conducted:

ANSI/BIFMA X5.4-2012 Lounge and Public Seating – Tests, American National Standard for Office Furnishings.

General Test Condition:

The following test program was conducted in a laboratory environment maintained at 15 °C to 25 °C and 50%±5 RH. The sample was individually tested after conditioning in the test environment for at least 24 hours prior to conducting the test.

The complete detailed procedures may be found in the referenced specification and are only summarized herein.

No. of Sample:

2 pieces (Sample 1 & 2). For more sample information and pictures, please refer to the following page.

Types of Lounge Seating: Single Seating (Type C). For the classification of types, please refer to Annex A.

Test	Test Description and Requirements	Test Results
Safety, Durability, and Structural Adequacy		
	Back Strength Test - Horizontal Static - Functional Load No loss of serviceability when 667N (150lbs.) is applied simultaneously for 1 min. Applied 90° to the back at 16in. above the seat.	PASS
5	Back Strength Test - Horizontal Static - Proof Load No sudden and major change in the structural integrity (loss of serviceability is acceptable) when 1112N (250lbs.) is applied simultaneously for 1 min. Applied 90° to the back at 16in. above the seat.	PASS
	Back Strength Test - Vertical Static - Functional Load No loss of serviceability when 890N (200lbs.) is applied simultaneously for 1 min. Applied 90° to the back at 16in. above the seat.	N/A
6	Back Strength Test - Vertical Static - Proof Load No sudden and major change in the structural integrity (loss of serviceability is acceptable) when 1334N (300lbs.) is applied simultaneously for 1 min. Applied 90° to the back at 16in. above the seat.	N/A
7	Back Durability Test - Horizontal – Cyclic No loss of serviceability in 120,000 cycles with a 102kg (225lbs.) in the center of each seat and a force of 334N (75lbf.) 90° to the center of the chair back.	PASS
8	Back Durability Test - Vertical – Cyclic No loss of serviceability after applying a vertical downward force of 890 N (200 lbf) at the top of the backrest for 10000 cycles.	N/A



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention:To check the authenticity of testing / inspection report & certificate, please contact us at telephone:(86-755) 8307 1443, or email: CN.Doccheck@sgs.com

If fighting immaintaited with 15 lights of the fighting immaintaited with 15 lights and solve a resource of the company.

1/F,1 Building,European Industrial Park, No.1 Strumte South Road, Wiustra Section, Deliang Town, Strunde, Fisshan, Guangdong, China 528333 t (86-757) 22805888 f (86-757) 22805888 www.sgsgroup.com.cn 中国・广东・佛山市原徳区大良街道办事处五沙原和南路1号欧洲工业园一号厂房首层 邮编: 528333 t (86-757)22805888 f (86-757)22805858 e sgs.china@sgs.com



Test Report No.: SDHL1703004942FT Date: Sep.26, 2017 Page 3 of 7

Test	Test Description and Requirements	Test Results
9	Arm Strength Test Horizontal –Static - Functional Load No loss of serviceability when apply horizontally inward and outward to the armrest at the most forward point of the armrest with the following	
	force, for 1 min. - For units with a distance between the arms less than 889 mm (35 in.), a force of 445 N (100 lbf.) - For units with distance between the arms greater than or equal to	N/A
	889 mm (35 in.), a force of 592 N (133 lbf.)	
9	Arm Strength Test Horizontal – Static - Proof Load No sudden and major change in the structural integrity (loss of serviceability is acceptable) when apply horizontally inward and outward to the armrest at the most forward point of the armrest with the following force, for 1 min. - For units with a distance between the arms less than 889 mm (35)	N/A
	in.), a force of 667 N (150 lbf.) - For units with distance between the arms greater than or equal to 889 mm (35 in.), a force of 890 N (200 lbf.)	
	Arm Strength Test Vertical – Static - Functional Load	
	No loss of serviceability when apply the vertical load uniformly applied along a 127mm (5in.) length at the apparent weakest point with the following force, for 1 min. - For units with armrest width of greater than 75 mm (3 in.) a force of 890 N (200 lbf.).	N/A
10	 For units with an armrest width of less than or equal to 75 mm (3 in.). a force of 750 N (169 lbf.). Arm Strength Test Vertical – Static - Proof Load 	
10	No sudden and major change in the structural integrity (loss of serviceability is acceptable) when apply the vertical load uniformly applied along a 127mm (5in.) length at the apparent weakest point with the following force, for 1 min. - For units with armrest width of greater than 75 mm (3 in.) a force of 1335 N (300 lbf.).	N/A
	- For units with an armrest width of less than or equal to 75 mm (3 in), a force of 1125 N (253 lbf.)	
	in.). a force of 1125 N (253 lbf.). Arm Durability Test for Multiple Seat Units - Horizontal – Cyclic	
11	There shall be no loss of serviceability when apply a 445 N (100 lbf.) force at an appropriate rate between 10 and 30 cycles per minute for 50,000 cycles.	N/A
12	Arm Durability Test for Multiple Seating Units - Vertical – Cyclic There shall be no loss of serviceability when apply a 667 N (150 lbf.) force at an appropriate rate between 10 and 30 cycles per minute for 10,000 cycles.	N/A
13	Arm Durability Test for Single Seat Units - Angular – Cyclic Simultaneously apply a force of 400 N (90 lbf.) to each arm initially at a 10° ± 1° degree angle for 60,000 cycles at a rate between 10 and 30 cycles per minute. There shall be no loss of serviceability to the unit.	N/A



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention:To check the authenticity of testing / inspection report & certificate, please contact us at telephone:(86-755) 8307 1443, or email: CN.Doccheck@sgs.com

1/16;1^{et} Building, European Industrial Park, No.1 Shunte South Read, Wissta Section, Dalaring Town, Shunde, Fisshan, Guangdong, China 528333 t (86-757)22805888 f (86-757)22805888 www.sgsgroup.com.cn 中国·广东·佛山市原德区大良街道办事处五沙顺和南路1号欧洲工业园一号厂房首层 邮编: 528333 t (86-757)22805888 f (86-757)22805858 e sgs.china@sgs.com



Test Report No.: SDHL1703004942FT Date: Sep.26, 2017 Page 4 of 7

Test	Test Description and Requirements	Test Results
	Seating Durability Tests – Cyclic	
14	No loss of serviceability after 100,000cycles impact. A weight of 57kg	PASS
	(125lbs.) free falls onto the seat from 3.6 in. height for each seating.	17.00
	Drop Test – Dynamic - Functional Load	
	No loss of serviceability when 102kg (225lbs.) weight free falls from	PASS
	6in. height to the center of the seat for each seating.	
15	Drop Test – Dynamic - Proof Load	
	No sudden and major change in the structural integrity (loss of	PASS
	serviceability is acceptable) when 136kg (300lbs.) weight free falls from	
	6in. height to the center of the seat for each seating.	
	Leg Strength Test -Front Load - Functional Load No loss of serviceability when A force of 334 N (75 lbf.) is applied once	N/A
	to each front leg individually for one (1) minute.	IN/A
	Leg Strength Test -Front Load - Proof Load	
16.3	No sudden and major change in the structural integrity (loss of	
	serviceability is acceptable) when A force of 503 N (113 lbf.) or a force	N/A
	equal to the weight of the entire unit, whichever is greater, is applied	
	once to each front leg individually for one (1) minute.	
	Leg Strength Test - Side Load - Functional Load	
	No loss of serviceability when a force of 334N (75lbf.) is applied once	N/A
	to each front and rear leg individually for 1 minute.	
16.4	Leg Strength Test - Side Load - Proof Load	
	No sudden and major change in the structural integrity (loss of	N/A
	serviceability is acceptable) when A force of 503 N (113 lbf.) or a force equal to the weight of the entire unit, whichever is greater, is applied	
	once to a front and rear leg individually for one (1) minute. Unit Drop Test – Dynamic	
	No loss of serviceability after lifting one end of the unit specified as	
	below and allowing it to drop freely. Repeat a) on the opposite end of	
	the unit.	
17	Drop Height for Lounge Seating Unit	N/A
	Unit Weight Drop Height	. 4/
	<45 kg (100 lbs.) 180 mm (7.1 in.)	
	45 - 90 kg (100-200 lbs.) 120 mm (4.7 in.) >90 - 136 kg (200 - 300 lbs.) 60 mm (2.4 in.)	
	>90 - 136 kg (200 - 300 lbs.) 60 mm (2.4 in.) > 136 kg (300 lbs.) n/a	
	Caster/Unit Base Durability Test for Pedestal Base Units	
10.1	There shall be no loss of serviceability. The caster shall not separate	N/A
	from the base as a result of the application of the 22 N (5 lbf.) force	
18.1	after 500 cycles over a hard surface with obstacles and 25, 000 cycles	
	over a smooth hard surface without obstacles under a 113kg (250lbs.)	
	load on the seat. Test stroke is 762mm (30in.) minimum.	



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention:To check the authenticity of testing / inspection report & certificate, please contact us at telephone:(86-755) 8307 1443, or email: CN.Doccheck@sgs.com

1/16;1^{et} Building, European Industrial Park, No.1 Shunte South Read, Wissta Section, Dalaring Town, Shunde, Fisshan, Guangdong, China 528333 t (86-757)22805888 f (86-757)22805888 www.sgsgroup.com.cn 中国·广东·佛山市原德区大良街道办事处五沙顺和南路1号欧洲工业园一号厂房首层 邮编: 528333 t (86-757)22805888 f (86-757)22805858 e sgs.china@sgs.com



Test Report No.: SDHL1703004942FT Date: Sep.26, 2017 Page 5 of 7

Test	Test Description and Requirements	Test Results
18.2	 Caster/Unit Frame Durability Test for Units with Legs There shall be no loss of serviceability. The caster shall not separate from the base as a result of the application of the 22 N (5 lbf.) force after the following tests under a 113kg (250lbs.) load on the seat. Test stroke is 762mm (30in.) minimum. For single seating units, the unit, or unit's frame with casters, shall be cycled for 500 cycles over the obstacles and then 25,000 cycles on a smooth hard surface without obstacles. Multiple seating units shall be cycled 250 cycles over the obstacles. 	N/A
19	Swivel Test – Cyclic No loss of serviceability after 120,000 cycles of rotation (360°) under a 113kg (250lbs.) load on the seat.	N/A
20	Tilt Mechanism Test – Cyclic No loss of serviceability after 200,000 cycles under a 102kg (225lbs.) load to the center of the seat	N/A
21.3	 Stability Test - Rear Stability for Non-tilting Units Load the seat (or, for multiple seat units, load the seat of one of the seating positions) with 6 disks. Apply a horizontal force to the highest disk. The location of the force application is 6 mm (0.25 in.) from the top of the disk. For units with seat height (as measured at the front of the bottom of the lowest disk when all disks are in the unit) less than 710 mm (28.0 in.), calculate the force as follows: F = 0.1964 (1195 – H) Newton. H is the seat height in mm. For units with seat height equal to or greater than 710 mm (28.0 in.), a fixed force of 93 N (20.9 lbf.) shall be applied. The application of the force shall not cause the unit to tip over. 	PASS
21.4	Stability Test - Rear Stability Test for Tilting Units Load one seat position with 13 disks. If the unit does not tip over and the tilt mechanism does not tilt to its most rearward position (i.e., at its tilt stop) when the disks are placed in the seat, the unit shall also be tested according to 21.3.1 with the unit in the unlocked position. The application of the force shall not cause the unit to tip over.	N/A
21.5	Stability Test - Front Stability A downward force shall be applied initially at 45° to the test platform by attaching a strap centered over the front portion of the seat. The force shall be applied until the total unit weight is transferred to the front support members. The force shall not be less than 40% of the unit weight.	PASS
22	Tablet Arm Load Ease Test – Cyclic No loss of serviceability to the unit after a 343 N (77 lbf.) force applied through a 203 mm ± 13 mm (8.0 in. ± 0.51 in.) diameter area centered on the writing area of the tablet for a total 100,000 cycles.	N/A



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention:To check the authenticity of testing / inspection report & certificate, please contact us at telephone:(86-755) 8307 1443, or email: CN.Doccheck@sgs.com

1/16;1^{et} Building, European Industrial Park, No.1 Shunte South Read, Wissta Section, Dalaring Town, Shunde, Fisshan, Guangdong, China 528333 t (86-757)22805888 f (86-757)22805888 www.sgsgroup.com.cn 中国·广东·佛山市原德区大良街道办事处五沙顺和南路1号欧洲工业园一号厂房首层 邮编: 528333 t (86-757)22805888 f (86-757)22805858 e sgs.china@sgs.com



Test Report No.: SDHL1703004942FT Date: Sep.26, 2017 Page 6 of 7

Test	Test Description and Requirements	Test Results
23	Tablet Arm Static Load Test Apply a load of 68 kg (150 lb) at the apparent weakest position for 1 minute and remove the load. The load applied once shall cause no sudden and major change in the structural integrity of the unit. After performing the test, the tablet arm must allow egress from the unit; other losses of serviceability are acceptable.	N/A

Annex A: Classification of Types of Lounge Seating

Single Seating	Multiple Seating
Style A - with arm(s) and with backrest	Style A - with arm(s) and with backrest(s)
Style B - with arm(s) and without backrest	Style B - with arm(s) and without backrests
Style C - without arms and with backrest	Style C - without arms and with backrest(s)
Style D - without arms and without backrest	Style D - without arms and without backrests

Remark:

- N/A Not applicable; N/R Not Requested; N/P Not provided.
- For the sample information and pictures, please refer to the following page.



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention:To check the authenticity of testing / inspection report & certificate, please contact us at telephone:(86-755) 8307 1443, or email: CN.Doccheck@sgs.com

1/F,1 Building,European Industrial Park, No.1 Strumte South Road, Wiustra Section, Deliang Town, Strunde, Fisshan, Guangdong, China 528333 t (86-757) 22805888 f (86-757) 22805888 www.sgsgroup.com.cn 中国·广东·佛山市原德区大良街道办事处五沙顺和南路1号欧洲工业园一号厂房首层 邮编: 528333 t (86-757)22805888 f (86-757)22805858 e sgs.china@sgs.com



Test Report No.: SDHL1703004942FT Date: Sep.26, 2017 Page 7 of 7


SAMPLE INFORMATION AND PICTURES

Weight: 23.75 kg

Overall Dimensions: 442 mm L x 457 mm D x 732 mm H


Other Dimensions: /

Sample as Received

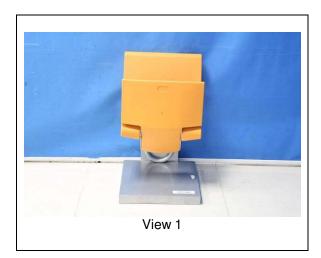





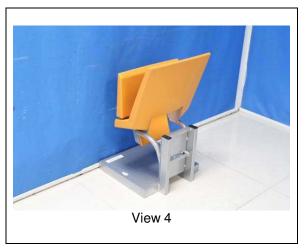

End of Report



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention:To check the authenticity of testing / inspection report & certificate, please contact us at telephone:(86-755) 8307 1443, or email: CN.Doccheck@sgs.com

1/F,1 Building,European Industrial Park, No.1 Strumte South Road, Wiustra Section, Deliang Town, Strunde, Fisshan, Guangdong, China 528333 t (86-757) 22805888 f (86-757) 22805888 www.sgsgroup.com.cn 中国·广东·佛山市原德区大良街道办事处五沙顺和南路1号欧洲工业园一号厂房首层 邮编: 528333 t (86-757)22805888 f (86-757)22805858 e sgs.china@sgs.com